

City of Wichita, Kansas
Americans with Disabilities Act Transition Plan
Ford Rockwell Branch Library

5939 E. 9th Street

July 2005



Prepared by

DMCG
Disability Management Consulting Group L.L.C.
2801 Jonquil Place
Columbia, MO 65202

In conjunction with

The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board

[illegible]

Legend: Blue font identifies hyperlinked documents – Red font indicates recommended changes to structures or policies

[illegible]

City of Wichita – ADA/504 Transition Plan – Ford Rockwell Library - July 2005

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies	Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
9. Men's and Women's Restrooms	The accessible toilet stalls comply with ADAAG clear floor space specifications (Fig 30(a)), but the toilet paper dispensers are located on the wrong wall.	4.17.3	The existing Toilet paper dispensers are located on the wall at the front of the water closet, not on the narrow side wall. Relocate the toilet paper dispensers to the wall on the narrow side of the stall under the existing side grab bar. See Support Information for more details.	M	M	M	10	\$100	Attachment #2 – TP Dispenser Location			
10. Men's Restroom	The urinal is mounted too high at 22-inches measured to the rim	4.18.2	At least one urinal in each restroom is required to be mounted so that the rim is no higher than 17-inches. Modify the exiting urinal so that the rim is 17-inches or lower.	L	M	M	9	\$250	Urinal			
11. Interior Spaces	Door hardware consists of knobs on the doors leading to the meeting room.	4.13.9	Door hardware, which does not require tight grasping or twisting-of-the-wrist to operate, complies with ADAAG specifications. Modify door hardware on one of the double doors by installing a lever insert over the door knob.	L	M	M	12	\$200	Attachment #3 – Door Hardware Knob Cover			
12. Drinking Fountain	Spout too high at 42-inches. Existing cup holder empty.	4.15.3	Cups at inaccessible drinking fountains are considered equivalent facilitation. Provide cups in cup holder.	L	M	M	13	\$40	ADA TAM 3 – P 34			

Conceptual Cost Projections

Total	\$4,765
Year One (Very High)	\$
Year Three (High)	\$3,500
Year Five (Medium)	\$125
Year Ten (Low)	\$1,140